B. M. Baba¹, M. L. Abubakar^{1*}, R.B. Raji², R. Ibrahim¹

- ¹ Kaduna State University, Kaduna
- ² Ahmadu Bello University, Zaria
- * Corresponding Author, muhdlawal@kasu.edu.ng

Abstract: This paper looks at the spatial distribution of electric transformers in Narayi Ward, Chikun Local Government Area of Kaduna State. Handheld GPS was used to obtain coordinates of electric transformers in Narayi Ward. Data on characteristics of transformers was obtained from Narayi Business Unit of Kaduna Electricity Distribution Company (KAEDCO). The coordinates were used to map the locations of the transformers. Average Nearest Neighborhood Analysis was used to show the pattern of distribution; Buffer Analysis was used to check the compliance with Nigerian Electricity Regulatory Commission (NERC) 10m standard; while query was used to show the transformer service life. Analysis revealed Average Nearest Neighborhood Analysis result showed random distribution at 0.01% significance level with 0.215604336939 ratio. Only 5 (19%) of the transformers complied with the safety standard of siting transformers at least 10m away from the main road. 2 (7%) of the transformers violated the American National Standards Institute/Institute of Electrical and Electronics Engineers (ANSI/IEEE) standards of 25 years in service. The study therefore recommends that transformers should be provided in the newly built up areas of Karji and Water Intake by KAEDCO. It also recommends that transformers located within 10m buffer zone across the major roads in the study area should be relocated away by the KAEDCO. This will promote safety of the road users and the general public. Future installations should also comply with the standards.

Keywords: Electricity, Spatial Analysis, GIS, Geodatabase, Nearest Neighborhood Analysis

INTRODUCTION

Nigeria has been experiencing inadequate power supply for decades. The privatization of the distribution companies over the years has not improved the supply of electricity nationwide. Previous administrations have made adequate supply of electricity their priority in order to boost industrial activities and the economy of the country. Apart from population growth and advancement in technology, electricity consumption has increased and this has led to expansion of the distribution network (Abana, 2018). Consequently, bringing private investors to take over the distribution of electricity as practiced all over the world is a good idea.

The power sector is crucial to national development. Any country carrying out developmental reforms must give priority to the power sector (Chatta, 2015). Generally, the crucial role played by the power sector in the economic development of a nation cannot be overemphasized (Awosope, 2014). As such, industrial growth, agriculture, infrastructure and virtually all sectors of the economy are dependent on reliable power supply. Nigeria ranks among the lowest in total net electricity generation globally (Abana, 2018). Power generation has been a problem for the country, with successive administrations budgeting huge amount of money to overcome the challenges. Power transmission process involve certain stages, this

include conveying generated electrical power from the plants to distribution stations, and subsequently to consumers (Yildirim & Nisanci, 2010).

Although adequate electricity supply is critical of nation building, power failures and load shedding are the characteristics of electricity supply in Nigeria (Kareem, 2006). Basic human activities now require the use of electricity. Depriving people of electricity in these days is tantamount to castration (Musa, 2009). According to Sule (2015), poor electricity supply is caused by multiple challenges affecting the generation and distribution of electricity. Some of the problems associated with electricity distribution in Nigeria include poor maintenance, mismanagement, inadequate funding and corruption (Stanley, 2012). This is evident in virtually all the sectors of the economy.

Electricity supply in Nigeria is seasonally dependent and generally unreliable. It is believed that there is better supply during the wet season (Ponnle, Popoola, & Ale, 2011). In the northwestern part of the country, there is a significant improvement in access to electricity from 36.6% to 42.2% as at 2013 (Guzomakem, 2015). However, despite the improvement, almost every Nigerian now has a generator to cater for his electricity demands (Okoendo, 2011). This has led to the country spending about \$\frac{1}{2}\$17.9 billion annually to import generators to cover for the shortfall in electricity supply.

The apparatus used to convert alternating current from one voltage to another is the transformer. Although they may be "step-up" or "step-down", they are designed to work on the magnetic induction principle. Transformers are not evenly distributed in Nigeria (Abana, 2018), and as a result of that, the rate of the utilization of each one may be high. Furthermore, the transformers used in distribution are of different capacities, sizes and functions. However, no matter the capacity or size, they play very critical role in the distribution phase (Chatta, 2015). Jasni et al. (2017) asserted that adequate supply of electricity is dependent on the conditions of the transformers since they are the backbone of the power supply. However, capital assets used in electricity distribution continue to deteriorate as a result of neglect, theft and vandalism, especially in rural areas (Olivia Phillip International Consulting, 2013).

Today in Nigeria, the sub-stations and injection stations are over 40 years old, and the electric transformers used in the distribution are very old, putting the transformers on serious ageing problem (Okoro & Chikuni, 2007). Overload and poor maintenance are other factors responsible for the breakdown of electric transformers (Sulaiman and Ali, 2011; Ijewere, 2006). Change in land use pattern (eg. Residential to commercial) can cause overloading of the existing transformers, causing their malfunction (Caven, 1998).

Due to the population growth and the spatial expansion in Narayi ward, the demand for adequate supply of electricity is just as it is the case in the entire country (Salihu, Olatunde, & Chukwudebe, 2014). However, despite the importance of the issue mentioned above, no study has focused on analyzing the spatial distribution of transformers, their compliance with NERC standards in Narayi ward, Chikun Local Government Area. This study therefore was aimed at analyzing the spatial pattern of distribution of electric transformers, creating a geodatabase and checking their compliance with NERC, ANSI/IEEE standards.

MATERIALS AND METHODS

STUDY AREA

Narayi Wards lies between latitude 10°27′49″ and 10°29′9″ North of the equator and longitude 7°26′27″ and 7°27′53″ east of Greenwich Meridian. The ward shares boundary with Patrick Yakowa Road to the east, and Barnawa to the west. It is bordered by River Kaduna to the north and Television (Unguwan Yelwa) to the south.

There are two (2) seasons in Narayi ward, the first is the rainy season and the wettest month is August. The average rainfall here is 1,300mm. The second is the dry season which starts from September to February annually.

Narayi ward experiences high temperature all year round, which is a characteristic of the tropics. The mean daily temperature in the area can be as high as 34 °C between months of March and May. Temperature could be as low as 20 °C during the December to January. This low temperature is intensified by humidity due to the dry Harmattan wind.

The vegetation type is the guinea savannah zone base on vegetation classification. The vegetation here suffers from anthropogenic disturbance through cutting down of trees for fuel wood, cultivation and construction works. Narayi ward lies within the plains of Hausaland, which slopes gently towards the desert and the streams drain north – east toward Lake Chad. The plains reach altitude of about 71m in the southern part and gradually decline in altitude north ward (Mortimore, 1970).

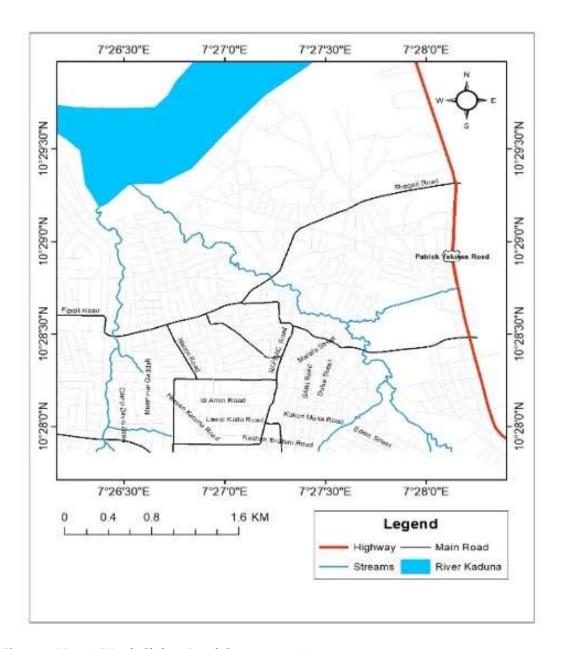


Figure 1: Narayi Ward, Chikun Local Government Area

Source: Authors' Analysis, 2019 **Reconnaissance Survey**

A preliminary survey was conducted by the researcher in order to be more familiar with the study area. During this phase of the research, a visit was paid to the KAEDCO officer in Chikun LGA and the office was officially informed about the study which specifically focused on the distribution of its facilities and the support of the management was solicited for, so as to ease the process of data collection.

Data Sources

Absolute location (Geographic Coordinates) of the existing electric transformers in Narayi Ward was obtained using handheld GPS device (Garmin 78S) with the aid of

a KAEDCO technical staff at the Narayi Business Unit. Data on the conditions and characteristics of the existing transformers were obtained from the KAEDCO Business Unit. Information such as the functionality of the transformers, average loading and year of installation were collected. Google Image of the study area. This was downloaded from the Google Earth Pro software, georeferenced and digitized as a base map for the study area.

GIS Analysis

Data obtained were analyzed as follows based on the set research objectives:

- The collected coordinates (point locations) were used to produce digital maps of the transformers. These point locations were overlaid and presented on a downloaded, georeferenced, and digitized base map of the study area as an electricity transformers map using ArcGIS 10.3 software.
- Nearest Neighbourhood Analysis (NNA) was employed to examine the distribution pattern of the transformers. The NNA uses the distance between each point and its closest neighbouring point to determine if point pattern is clustered, random or dispersed. The result was generated from the NNA analysis carried out using ArcGIS 10.3 software which gives clustered points when the Nearest Neighbourhood Index (NNI) is tending towards 0, random when it is closer or equal to 1.0 and regular when the result is closer or equal to 2.15 (Sherwood, 1970).
- A geodatabase was created for both the spatial and attributes data of the
 electricity distribution transformers in Narayi ward from which, queries, were
 made to answer other research questions and manipulations, updates and
 retrievals can be made with time. The coordinates and their attributes were
 copied into Microsoft Excel 2007 environment from the GPS device and then
 saved as CSV (comma delimited) format. This was then imported into ArcGIS
 10.3 from which queries were made for subsequent analyses.
- Buffer Analysis was employed to achieve this objective in line with ANSI/IEEE
 (1989) standards. The standards approve a Safety Clearance of 10m distance of
 transformers from major roads as also enshrined in the NERC (2016)
 Distribution Code for Nigerian Electricity Distribution System. A 10m buffer
 zone was created around each transformer and the transformers whose buffer
 zones encroach into major roads were mapped out.
- The years of service were gotten by simple arithmetic applied on the record obtained from the KAEDCO Narayi Business Unit, i.e. the year of commission of each transformer was subtracted from 2017 giving its years in service. The results for all the transformers were subjected to the ANSI/IEEE (1989) standards in order to identify those that have spent more than the required years in service. The standards approve maximum of 25 years of transformers in service, and Transformers that have spent 25 years and beyond in service

were identified by querying the 'DATE_COMM' field of the geodatabase and shown on the map.

RESULTS AND DISCUSSION

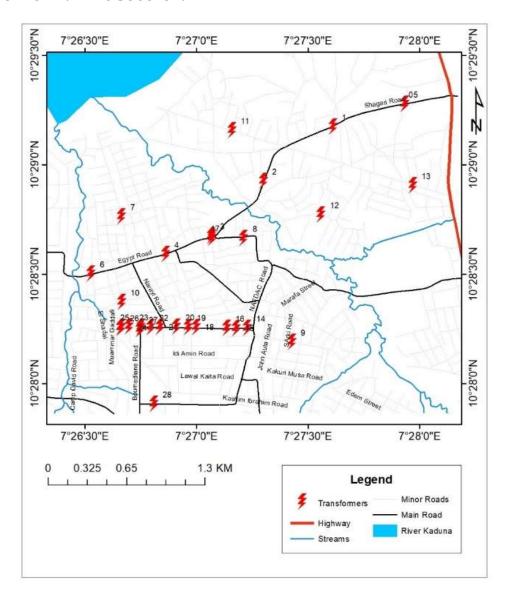


Figure 2: Location of Public Transformers in Narayi ward **Source:** Authors' Analysis, 2019

There are a total of 27 public transformers accounting for 93% of the overall transformers in Narayi ward. Transformers in this category have different capacities, mostly ranging from 300kVA to 500kVA. They are purchased, installed and maintained by the distribution company (KAEDCO) for the general public in the areas located. They are spatially distributed across all parts of the study area in varying patterns due to the mixture of the urban land uses. This is due to the fact that the areas

are mostly made up of residential buildings of the middle and the lower income earners who do not use personal transformers dedicated for their own use but rather rely on the public ones.

There are a total of 2 dedicated transformers accounting for 7% of the overall total of distribution transformers in Narayi ward. The two transformers are located in NAFDAC Premises.

Table 1: Transformers in Narayi Ward based on their Capacities

Table 1 shows the distribution of transformers in Narayi ward according to their capacity.

Capacity (kVA)	No	Percentage %
50	13	45
300	5	17
500	10	35
33k	1	3
Total	29	100

Source: Authors' Analysis, 2019

Transformers with 50kVA are mostly pole-mounted across newly built-up areas of High Cost and few others sited at 9mobile, Airtel, Glo and MTN masts. There are those with 300kVA which are sited at NAFDAC buildings as well as residential areas. Transformers with 500kVA were mostly located in public residential areas. The 15v transformers are located within KAEDCO substation in Narayi and they make up the Injection Station for the Business Unit.

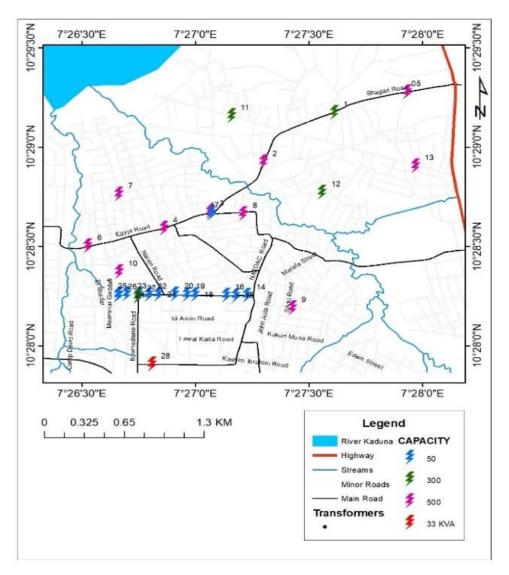


Figure 3: Spatial Distribution of Transformers in Narayi ward by Capacity **Source:** Authors' Analysis, 2019

Spatial Pattern of Location of Transformers in Narayi Ward

Nearest Neighborhood Analysis (NNA) is a very important tool for determining the spatial distribution pattern of objects on the surface of the earth. This spatial analytical tool of GIS in ArcGIS 10.3 was employed to examine the distribution pattern of the electricity transformers in Narayi ward. The result shows clustered points at 0.01% significance level with the Nearest Neighbour Ratio (NNR) of 1.020928 (See Figure 4.2).

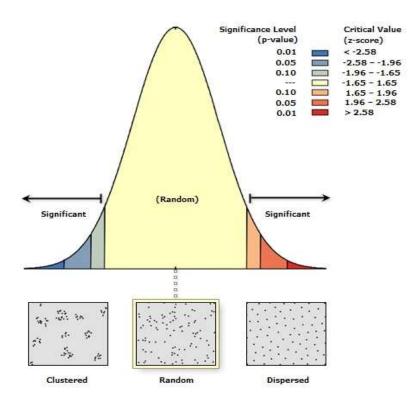


Figure 4: The Distribution Pattern of Transformers in Narayi Ward **Source:** Authors' Analysis, 2019

Given the z-score of 0.215604336939, the pattern appears to be random.

Average Nearest Neighbor Summary

Observed Mean Distance:	219.0507 Meters
Expected Mean Distance:	214.5603 Meters
Nearest Neighbor Ratio:	1.020928
z-score:	0.215604
p-value:	0.829296

Based on the average nearest neighbor summary results, the observed mean distance from one transformer to another is 219.0507m resulting to random distribution. This is just a little above the expected mean distance of 214.5603m which results to regular distribution pattern. The random nature of the transformers distribution is as a result of the mixed-nature of the various urban land-uses which is responsible for the differences in electric power demand and supply which also affects the location of electricity distribution facilities. For instance, most of the 50kVA transformers are

found within the new residential area of High Cost and few others sited at mobile tower masts.

Geodatabase of Transformers in Narayi Ward

Geodatabase plays a key role in GIS analysis. It provides the opportunity for information on objects to be stored, manipulated, retrieved and updated with time. It is the process whereby real-world entities and their interrelationships are analyzed and modeled in such a way that maximum benefits are derived while utilizing minimum amount of data (Damilola, 2015). A geodatabase was created not just to help in satisfying the other objectives of this work, but also for future purposes since data in a database can be updated with time. The geodatabase contains both spatial and attribute data (See Figure 5).

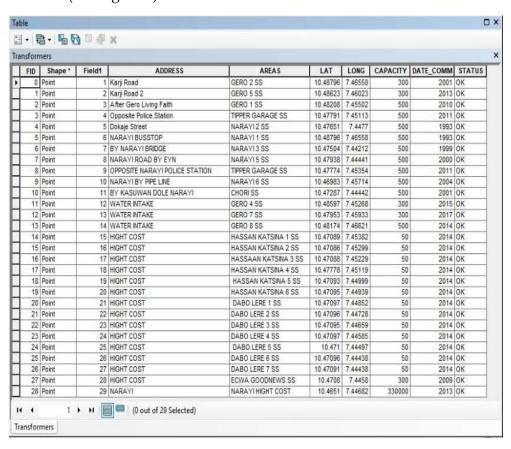


Figure 5: The Attribute Table of the Geodatabase of Electricity Transformers in Narayi **Source:** Authors' Analysis, 2019

The spatial data include the coordinates of the transformers point locations stored in terms of Northings and Eastings. This data is a very important element of the geodatabase because it provides information about the geographical location of the individual transformers in Narayi Ward. Some of the attribute data built in the geodatabase include: type of transformer, year of installation, service years, address,

feeder and capacity. Data on all these variables are important and being in the geodatabase, they can provide additional information about the transformers at any time need. With these in the database, query can be made to display the actual locations of either all or a particular category of transformers (See Figure 6).

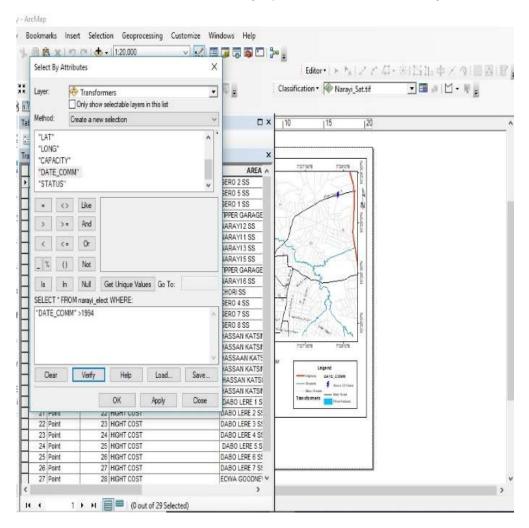


Figure 6: Screen-print of Geodatabase Query Processes

Source: Authors' Analysis, 2019

This geodatabase is in line with the ones created by Ighalo and Williams (2012) and Kanmani and Suresh (2014) with little differences in the attributes of transformers. The geodatabase in this present study bridge the gap left by Omilabu et al. (2015). This is because in this work, concentration was only on the step-down transformers but, in a far wider area than theirs. Also, data such as voltage amperes, load, and year of installation, year of manufacture, manufacturer, and asset code has been added to those created in their study. Ogbokwe and Njoku (2015) used only two transformers in their study area which revealed the small nature of the study area. In contrast, this study used information on 324 transformers with more comprehensive attributes than theirs.

Compliance with NERC (2016) Standards for Siting Transformers

A Safety clearance of 10m buffer zones were created around each transformers in Narayi Ward that are along the road; and a query was made to unravel the number of transformers that violate the setback regulations set by the NERC (2016) standards as supported by the IEC (2016) electrical installation standard and the IEEE (1993) standards for siting transformers which specify a 10m distance from major roads. The query result indicated that 11 transformers accounting for 3.4% were below the above standards, which states that distribution transformers should be sited at least 10m away from main roads (See Figure 7). These transformers were located less than 10m away from the main roads.

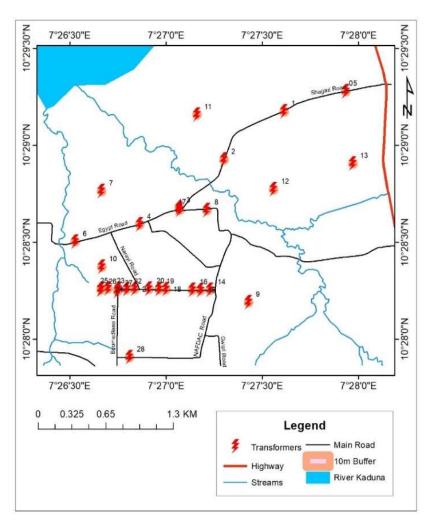


Figure 7: Transformers Sited within 10m Buffer from Major Roads **Source:** Author's Analysis, 2019

These transformers that violate the standard were mostly located within the city center and road intersections, where there are a lot of traffic and commercial activities. This implies that such areas are at high risk of fire incidences, accidents, transformer explosions, effects of Electromagnetic Fields (EMF) among other dangers associated with transformer faults.

Transformer Service Life

Electricity transformers have the capabilities, under normal operating conditions, to serve far beyond their required expected years of disposal, but the consequences of engaging very old transformers are enormous. These may include deterioration of insulation materials, power outage, fire incidences, increased temperature of the equipment and explosion among others.

The ANSI/IEEE (1989) standard for transformer service as recorded by the U.S. Department of Interior and Bureau of Reclamation (2005) and also reported by Shomolu (1994) is 25 years. Figure 8 reveals the result of the query operation carried out on the geodatabase to map out the transformers that have spent 25 years and above in service within Narayi Ward.

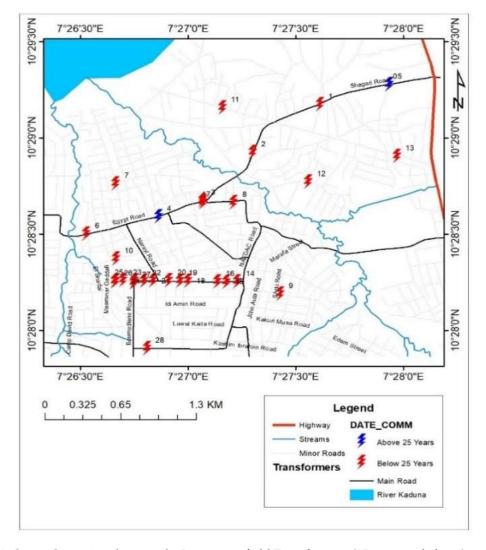


Figure 8: Query Operation showing the Locations of old Transformers (25 years and above) **Source:** Author's Analysis, 2019

Appendix contains the coordinates, type, year of commission, years of service and the locations of the transformers that exceeded the maximum 25 years in service within Narayi ward. These transformers were identified from the geodatabase created.

CONCLUSION

In conclusion, the spatial distribution of electricity transformers in Narayi ward is random in areas where there are concentrations and mixture of urban land use activities. The geodatabase created contains useful data which can always be manipulated, retrieved and updated with time. Also, 5 (19%) of the transformers complied with the safety standard of siting transformers at least 10m away from the main road. Two 2 (7%) distribution transformers have served beyond their useful life span of 25 years and 16 (34%) are located within the 10m buffer zone across the main roads of the study area.

RECOMMENDATIONS

The study recommends that:

- i. KAEDCO should deploy more transformers, for efficient power supply. Regular maintenance should also be carried out on the existing transformers.
- ii. Transformers located within the 10m buffer zone close to major roads should be relocated. Any future installations should also comply with the standard.
- iii. Transformers that are in service for more than 25 years should be replaced with new one in order to avoid sudden breakdown in distribution.
- iv. KAEDCO as a distribution company should also build a comprehensive geodatabase of all it's assets to improve information collection and analysis. This will help in decision making.

REFERENCES

- Abana, S. (2018). Analysis of spatial distribution of electricity transformers in Jimeta, Yola-North Local Government Area of Adamawa State, Nigeria. An Unpublished Thesis at the Department of Geography. Zaria: Ahmadu Bello University.
- Abdelmalik, A. A. (2014). *Power Transformer Life Management; relevance to Nigerian power industry.* Zaria, Nigeria: Department of Physics, Ahmadu Bello University.
- ANSI/IEEE. (1989). Standard General Requirements for Dry-Type Distribution, Power, and Regulating Transformers, C57.12.01. Retrieved from https://standards.ieee.org/findstds/prod/cds/powerdistribution.pdf

- Awosope, C. A. (2014). Nigerian Electricity Industry: Issues, Challenges, and Solutions. Covenant University, Public Lecture Series. Vol.3 (2). Available online at http://covenantuniversity.edu.ng/content/download/35621/245141/version/1/file/38th+Pu.
- Caven, B. (1998). *Optimization of the Reliability of Electricity Power Supply in Nigeria A* working paper presented in NEPA Headquarters. Vol. 1 pg 39 41. Lagos, Nigeria: NEPA.
- Chatta, G. O. (2015). Spatial Distribution and Utilization of Electricity Transformer in Sabon Gari Local Government Area Zaria, Kaduna State, Nigeria. An unpublished M.Sc Dissertation Submitted to the Department of Geography. Zaria: Ahmadu Bello University.
- Damilola, D. A. (2015). *Geospatial Modelling of Electricity Distribution Network. Geospatial Communication Network. PP 1-7. Accessed on September 10, 2016.*Retrieved from http://repository.fuoye.edu.ng/bitstream/123456789/978/1/geospatial.pdf
- Ighalo, G. I., & Williams, A. A. (2012). Simulating Power Distribution Network in Nigeria The Ikpoba-Hill District Network as a Case Study. *International Journal of Scientific & Technology Researc.* 1 (9).
- Ijewere, A. (2006). *The Management of Electricity Power Supply in Nigeria: Problems and Prospects. Unpublished Thesis at the Department of Business Administration University of Benin.* Benin City, Edo State: University of Benin.
- Jasni, J., Azmi, A., Azis, N., Yahaya, M. S., & Talib, M. A. (2017). Assessment of Transformer Health Index Using Different Models. . *Pertanika Journals of Science and Technology. Pertanika J. Sci. and Technol.* 25, (S): 143 150.
- Kanmani, B., & Suresh, B. S. (2014). Electricity Distribution System using Geospatial Technology–A Case Study for Hosur Town, Krishnagiri District. *International Journal of Computer Science and Information Technologies*. *5* (2), 1296-1300.
- Kareem, A. (2006). Maintenance of Electricity Power System and Equipment. *NSE Procedure Of the National Engineering Conference* (pp. 34-42). Nigerian Society of Engineers.
- Musa, D. A. (2009). *The Economics of Electric Power Supply in Nigeria*. Retrieved from Gamji: http://gamji.com/article9000/news9075.htm
- Nigerian Electricity Regulatory Commission. (2016). *The Distribution Code for the Nigeria Electricity Distribution System. The NERC official Library.*
- Okoendo, C. (2011). Evaluation of National Electric Power Authority (NEPA) Utility Information Infrastructure Towards Steady Power Supply by the End of 2010: A case Study of Bida NEPA. *Proceedings of the Technical Session of the 37th*

- Annual General Conference and Meeting of Nigerian Institution of Surveyors, (pp. 63-67). Owerri, Imo.
- Okoro, O. I., & Chikuni, E. (2007). Power Sector Reforms in Nigeria: Opportunities and Challenges. *Journal of Energy in Southern Africa, Vol. 18. No 3 August, 2007,* 21-36.
- Olivia Phillip International Consulting. (2013). *Nigeria: Electric Power Sector Report* 2013. 400 Pages SKU: OP5078820.
- Omilabu, J. O., Igbokwe, J. I., Ejikeme, J. O., Igbokwe, E. C., & Njoku, R. E. (2015). Development of Utility Information System for Management of Electricity Distribution of Iyaji Residential Layout, Oyo, Oyo State, Nigeria. *International Journal of Scientific & Engineering Research.* 6 (9).
- Ponnle, A. A., Popoola, J. J., & Ale, A. O. (2011). Reliability Worth Assessment of Electric Power Utility in Nigeria: Residential Customer Survey results. *AUJT*, 217-234.
- Salihu, T., Olatunde, O., & Chukwudebe, G. (2014). *Marketing Electrical Power in a Deregulated Environment: Nigeria as a Case Study. A1-5. Fullpaper- Power Marketing Tunde Salihu. A PDF Material, Accessed on the 14th February, 2017*. Retrieved from http://www.wfeo.org
- Shomolu, F. O. (1996). Equipment life Expectancy as a power Transmission/ Distribution system Planning factor: A working paper presented to NEPA headquarters. Lagos-Nigeria: NEPA.
- Stanley, C. (2012). *Electricity Generation and the present Challenges in the power sector.*Abuja, Nigeria: Energy Commission of Nigeria.
- Sule, I. K. (2015). *KEDCO explains power shortage in Kaduna, others. Daily Trust NewsPaper*. Retrieved from Daily Trust: http://dailytrust.com.ng/daily/index.php/news/47558-kedco-explains-power-shortage-in-kaduna-others
- Suleiman, K., & Ali, U. A. (2013). Reliability Analysis of Distribution Transformers: A case study of Gwiwa Business Unit, Sokoto. *Greener Journal of Science, Engineering and Technological Research, Vol. 3* (3), 088-092.
- Yildirim, V., & Nisanci, R. (2010). *Developing a Geospatial Model for Power Transmission Line Routing in Turkey. Spatial Information Modelling II.* Available online at www.harita.ktu.edu.tr/volkan.